

MAINTENANCE RECORD

Reg #: N22629
 Model: Cessna T206H
 Serial #: T20608567
 Work Order #: 19457



Hobbs: 116.3
 Tach: 101.6
 Total Time: 101.6
 Date: 12/27/05

SIGNATURE,
 DATE TYPE
 NUMBER

ETT: 101.6

 
Performed 100 hour inspection using Cessna T206H maintenance manual progressive care operations 1, 2, 3, 4, 5, 17, and 21 as a guide. Changed oil and filter. Took SOAP sample. C/W SB480E by inspection of filter and suction screen. No metal noted. Cleaned and reinstalled screen with new gasket. Installed new filter p/n CH48110-1. Serviced with 12qts Aeroshell 15W50. Checked compression: #1)76/80 #2)74/80 #3)77/80 #4)75/80 #5)78/80 #6)75/80. C/W AD 2002-26-01 fuel injector lines and support clamps inspection. No defects noted. Due next: 12-2006/Tach: 201.6. Tightened oil dipstick tube and re-safetied. Washed engine. Ground ran aircraft. Ops check normal. No leaks noted at this time. For further details see WO# 19457 on file this station. I certify that this engine has been inspected i/a/w a 100 hour inspection and is approved for return to service.

Thomas J. Fadzell
 For: Air Care, Inc.
 FAA Repair Station
 ACOR030C

MAINTENANCE RECORD

DATE
 T
 II
 HOL

Reg #: N22629
 Model: Cessna T206H
 Serial #: T20608567
 Work Order #: 19453



Hobbs:
 Tach: 101.6
 Total Time:
 Date: 12/30/05

SIGNATURE,
 DATE TYPE
 NUMBER

Removed engine driven fuel pump for repair. Pump overhauled by CRS# NE2R028L WO# R05-09137. Reinstalled pump with new gasket. Ground run aircraft. Ops check normal. No leaks noted at this time. For further details see WO# 19453 on file this station.

Thomas J. Fadzell
 For:
 FAA Repair Station
 ACOR030C

MAINTENANCE RECORD

DATE	TOTAL TIME IN SERVICE		DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
	HOURS	10THS		
			<p>Witham Field Aircraft Services, Inc.</p> <p>MAKE: CESSNA MODEL: T206H S/N: T20608567 N22629 Engine DATE: 3/31/2006 TACH: 156.4 HOBBS: 179.4 W.O.#: 8242</p> <ul style="list-style-type: none"> • Drained oil, removed – cut open – and inspected oil filter, no defects found. Installed new filter P/N CH48110-1 and serviced with 11 quarts of Aeroshell "W100 Plus" oil. Ran engine and checked for leaks, no leaks noted. <p>SIGNED: <i>Joseph Yaghi</i></p> <p>Witham Field Aircraft Services 2555 SE Dixie Hwy, Hangar 2 Stuart, FL 34996 FAA CRS WUMR153L</p>	

MAINTENANCE RECORD

DATE	TOTAL TIME IN SERVICE	DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
	HOURS		
		<p>Witham Field Aircraft Services, Inc.</p> <p>MAKE: CESSNA MODEL: T206H S/N: T20608567 N22629 ENGINE DATE: 6/9/2006 TACH: 207.3 HOBBS: 239.9 ACTT: 207.3 W.O.#: 8289</p> <ul style="list-style-type: none"> • Complied with Cessna Annual Inspection checklist. • Compressions: 1) 78/80 2) 79/80 3) 78/80 4) 78/80 5) 77/80 6) 79/80. • Drained oil, removed – cut open – and inspected oil filter, no defects found. Installed new filter P/N CH48110-1 and serviced with 11 quarts of Aeroshell 15W50 oil. Ran engine and checked for leaks, no leaks noted. <p>WITHAM FIELD AIRCRAFT SERVICES, 2555 S.E. DIXIE HWY., HANGAR 2, STUART, FL 34996</p> <p>WO#: 8289 DATE: 6/9/2006 I CERTIFY THAT THIS ENGINE HAS BEEN INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION IN ACCORDANCE WITH FAR 43 (APR), (D) AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION. ACTT: 207.3 TACH: 207.3 HOBBS: 239.9</p> <p>SIGNED: <i>Joseph Yaghi</i></p> <p>Authorized Signature FAA CRS WUMR153L</p>	

MAINTENANCE RECORD

DATE	TOTAL TIME IN SERVICE		DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
	HOURS	10THS		



LINDAIR SERVICES LTD.

5180 AIRPORT ROAD SOUTH
 VANCOUVER INTERNATIONAL AIRPORT
 RICHMOND, BC V7B 1B4
 PHONE: (604) 273-4511 FAX: (604) 273-5643
 Email: support@lindairservices.com

DATE : August 25, 2006	W/O: 12 - 0524	A/C REG: N22629	A/C S/N: T20608567
<i>Details of Work:</i>			
1 Oil changed (Shell W100) and oil filter inspected.			
2 New induction plenum bolt installed.			
3 De-ice boots removed and new de-ice boots installed.			
The maintenance described above has been performed in accordance with the applicable standards of airworthiness			
AMO : 10-87	Signature of AME : <i>Sam</i>		Licence # : 10-87

MAINTENANCE RECORD

DATE	TOTAL IN SER	DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
	HOURS		
		<p>Witham Field Aircraft Services, Inc.</p> <p>MAKE: CESSNA MODEL: T206H S/N: T20608567 Engine DATE: 7/27/2006 TACH: 250.1 N22629 W.O.#: 8332</p> <ul style="list-style-type: none"> Drained oil, removed – cut open – and inspected oil filter, no defects found. Installed new filter P/N CH48110-1 and serviced with 11 quarts of Aeroshell "15W50" oil. Ran engine and checked for leaks, no leaks noted. <p>SIGNED: <i>Joseph Zeyl</i></p> <p>Witham Field Aircraft Services 2555 SE Dixie Hwy, Hangar 2 Stuart, FL 34996 FAA CRS WUMR153L</p>	

MAINTENANCE RECORD

DATE	TOTAL TIME IN SERVICE		DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
	HOURS	10THS		
			<p><u>Witham Field Aircraft Services, Inc.</u></p> <p>MAKE: CESSNA MODEL: T206H S/N: T20608567 Cessna N22629 ENGINE DATE: 8/8/2006 TACH: 256.6 HOBBS: 298.2 W.O.#: 8344</p> <ul style="list-style-type: none"> Complied with SB 06-71-02 (fuel hoses inspection), no defects found. Verified AD 2006-12-07 does not apply, affected ECI cylinders are not installed on this engine. Verified Lycoming SB 569 does not apply per engine serial number. <p>SIGNED: <u>Joseph Yeager</u></p> <p>Witham Field Aircraft Services 2555 SE Dixie Hwy, Hangar 2 Stuart, FL 34996 FAA CRS WUMR153L</p>	

MAINTENANCE RECORD

DATE	TOTAL TIME IN SERVICE		DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
	HOURS	10THS		
			<p><u>Witham Field Aircraft Services, Inc.</u></p> <p>MAKE: CESSNA MODEL: T206H S/N: 08567 Cessna N22629 ENGINE DATE: 9/7/2006 TACH: 310.4 W.O.#: 8361</p> <ul style="list-style-type: none"> Adjusted idle fuel mixture, ops ck normal. <p>WITHAM FIELD AIRCRAFT SERVICES 2555 SE DIXIE HWY, HANGAR 2, STUART, FL 34996</p> <p>SIGNED: <u>Joseph Yeager</u></p> <p>Authorized Signature FAA CRS WUMR153L</p>	

MAINTENANCE RECORD

DATE	TOTAL TIME IN SERVICE		DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
	HOURS	10THS		
			<p><i>Witham Field Aircraft Services, Inc.</i></p> <p>MAKE: CESSNA MODEL: T206H S/N: 08567 N22629 ENGINE DATE: 10/12/2006 TACH: 373.1 W.O. #: 8393</p> <ul style="list-style-type: none"> • Drained engine oil, removed and cut open oil filter for inspection, no defects found. Installed new oil filter P/N CH48110-1 and serviced engine with 11 quarts Aeroshell 15W50 oil. Ran engine and checked for leaks, no leaks noted. <p>WITHAM FIELD AIRCRAFT SERVICES 2555 SE DUNE HWY, HANGAR 2, STUART, FL 34996</p> <p>SIGNED <u><i>Joseph Yeager</i></u> Authorized Signature FAA CRS WUMR153L</p>	

MAINTENANCE RECORD

DATE	TOTAL TIME IN SERVICE		DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
	HOURS	10THS		
			<p><i>Witham Field Aircraft Services, Inc.</i></p> <p>MAKE: CESSNA MODEL: T206H S/N: 08567 N22629 ENGINE DATE: 11/14/2006 TACH: 349.2 HOBBS: 400.7 ACTT: 349.2 W.O. #: 8435</p> <ul style="list-style-type: none"> • Complied with 100 hour inspection per Cessna 100 hour checklist. • Compressions: 1) 71/80, 2) 65/80, 3) 72/80, 4) 67/80, 5) 74/80, 6) 74/80. • Drained engine oil, removed and cut open oil filter for inspection, no defects found. Installed new oil filter P/N CH48110-1 and serviced engine with 11 quarts Aeroshell 15W50 oil. Ran engine and checked for leaks, no leaks noted. • Replaced rocker cover gaskets on cylinder numbers 1,2,3,5 & 6 with new P/N 76036. • Complied with AD2002-26-01 per SB342E. Next due in 100 hours, next annual inspection, or whenever work is performed on fuel Injection system. • Performed engine run and checked for leaks, no leaks noted. <p>WITHAM FIELD AIRCRAFT SERVICES 2555 SE DIXIE HWY, HANGAR 2, STUART, FL 34996</p> <p>SIGNED <u><i>Joseph Yeager</i></u> Authorized Signature FAA CRS WUMR153L</p>	

MAINTENANCE RECORD

DATE	TOTAL TIME IN SERVICE		DESCRIPTION OF THE WORK PERFORMED
	HOURS	10THS	
			<p align="center"><i>Witham Field Aircraft Services, Inc.</i></p> <p align="center">Cessna ENGINE</p> <p>MAKE: CESSNA MODEL: T206H S/N: 08567 N22629 ENGINE DATE: 7/20/2007 TACH: 437.7 HOBBS: 503.6 ACTT: 437.7 W.O. #: 8655</p> <ul style="list-style-type: none"> Complied with Annual engine inspection per Cessna checklist. Complied with AD 2007-08-03 (fuel line torque) per Cessna SB07-71-01 RL. Drained engine oil, removed oil filter and cut open for inspection, no defects found. Inspected oil suction screen, no defects found. Installed new oil filter P/N CH48110-1 and serviced with 9 quarts Aeroshell 15W50. Replaced all 12 spark plugs with new plugs P/N RHB37E. Complied with AD 2002-26-01 per SB342E, next due in 100 hours, next annual inspection, or when work is performed on fuel injection system whichever is first. Performed engine run and checked for leaks, no leaks noted. <p>WITHAM FIELD AIRCRAFT SERVICES 2555 SE DIXIE HWY, HANGAR 2, STUART, FL 34996</p> <p>SIGNED: <u>Joseph York</u> Authorized Signature FAA CRS WUMR153L</p>

Witham Field Aircraft Services, Inc.

MAKE: CESSNA MODEL: T206H S/N: 08567 N22629
 DATE: 7/20/2007 TACH: 437.7 ACTT: 437.7 W.O. #: 8655

• Complied with AD 84-26-02 by replacement of paper induction air filter P/N P197268. Filter due replacement no later than each 500 hours per AD requirements.

WITHAM FIELD AIRCRAFT SERVICES
 2555 SE DIXIE HWY, HANGAR 2, STUART, FL 34996

SIGNED: Joseph York
 AUTHORIZED SIGNATURE
 FAA CRS WUMR153L

Cessna ENGINE

MAINTENANCE RECORD

DATE	TOTAL TIME IN SERVICE		DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
	HOURS	10T		
			<p align="center"><i>Witham Field Aircraft Services, Inc.</i></p> <p align="center">Cessna ENGINE</p> <p>MAKE: CESSNA MODEL: T206H S/N: 08567 N22629 ENGINE DATE: 12/28/2007 TACH: 485.8 ACTT: 485.8 W.O. #: 8810</p> <ul style="list-style-type: none"> Complied with Annual engine inspection per Cessna checklist. Compressions: 1) 74/80, 2) 74/80, 3) 75/80, 4) 78/80, 5) 74/80, 6) 77/80. Drained engine oil, removed oil filter and cut open for inspection, no defects found. Inspected oil suction screen, no defects found. Installed new oil filter P/N CH48110-1 and serviced with 10 quarts Aeroshell 15W50. Complied with AD 2002-26-01 per SB342E, next due in 100 hours, next annual inspection, or when work is performed on fuel injection system whichever is first. Performed engine run and checked for leaks, no leaks noted. <p>WITHAM FIELD AIRCRAFT SERVICES 2555 SE DIXIE HWY, HANGAR 2, STUART, FL 34996</p> <p>WO#: 8810 DATE: 12/28/07 I CERTIFY THAT THIS ENGINE HAS BEEN INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION IN ACCORDANCE WITH FAR 43 (APP), (D) AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION. ACTT: 485.8 TACH: 485.8 HOBBS: XXXXX</p> <p>SIGNED: <u>Joseph York</u> AUTHORIZED SIGNATURE FAA CRS WUMR153L</p>	

MAINTENANCE RECORD

DATE	DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER

Witham Field Aircraft Services, Inc.

Cessna

MAKE: CESSNA MODEL: T206H S/N: 08567 N22629 ENGINE
 DATE: 2/4/2009 TACH: 605 ACTT: 605 W.O. #: 9148


- Complied with annual inspection per FAR 43 (APP)(D).
- Compressions: 1) 77/80, 2) 70/80, 3) 75/80, 4) 73/80, 5) 71/80, 6) 68/80.
- Replaced oil with 10 quarts Aeroshell 15W50, replaced filter with CH48110-1. Inspected old filter for metal, no defects found.
- Complied with Cessna SB 08-74-01, per Slick SB3-08 (carbon brush & distributor block inspection). Replaced carbon brush P/N K3215 in both magnetos, and distributor block assy P/N K3823 in right magneto. Work done IAW Unison L-1363C maint. Manual, ops check normal.
- Complied with Slick 500 hour magneto inspection per Unison L-1363C manual.
- Complied with Lycoming SB 388C, exhaust valve guide inspection.
- AD 2007-04-19 R1 does not apply since "Superior" cylinders are not installed.
- AD 2009-02-23 does not apply since fuel servo has never been removed or replaced since new in 7/2005.
- Complied with AD 2008-14-07 per SB342E, due each 100 hours, engine overhaul, or when fuel injector line clamps are loosened, whichever is first.
- Removed #2 cylinder for exhaust stud replacement. Reinstalled same cylinder after repair.
- Replaced all (6) rocker cover gaskets with new P/N 76036.
- Replaced all (6) intake gaskets P/N 71973 & seals P/N 72711.
- Replaced all (6) exhaust gaskets P/N LW18234.
- Replaced (10) rocker shaft gaskets P/N 66732.
- Replaced (1) rocker shaft cap P/N LW11665 on #2 cylinder exhaust position.
- Performed engine run and checked for leaks, no leaks noted, ops check normal.

WITHAM FIELD AIRCRAFT SERVICES
 2315 SE WITHAM FIELD DR. STUART, FL 34996

WO#: 9148 DATE: 2/4/2009

I CERTIFY THAT THIS ENGINE HAS BEEN INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION IN ACCORDANCE WITH FAR 43 (APP), (D) AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION.
 ACTT: 605 TACH: 605 HOBBS: 702.8

SIGNED

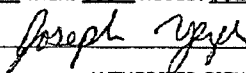

AUTHORIZED SIGNATURE
 FAA CRS WUMR153L